

插入型絕緣/金屬軸式編碼規則

RV 09 A X F - 40 E1 - 20 F X - B 5K - X X XXX
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15

1. Product Line

RV Rotary Potentiometer

2. Model

3. Structure Difference

4. Derivatives

5. RoHS Version

F indicates RoHS Compliance

6. Type of Terminal

Code	Type of Terminal
10	Solder lug
20	PC board (horizontal)
30	PC board (vertical);front
40	PC board (vertical);back

7. Type of Bushing

8. Shaft Length

9. Type of Shaft

10. Axis Angle of F-type Shaft

11. Pattern of Resistance Curve

12. Resistance Value

13. Materials & Methods for Manufacturing Shaft & Bushing

14. Number of Click

Code	Specification
0	None
C	Center Click
D	11 Positions click
E	21 Positions click
F	41 Positions click

15. Serial No.

訂單指定事項：

開立訂單時，用途請依下表記載予以指定製品之規格詳細記載並確認之。

項目：

1. 型號。
2. 公稱阻值及線性要求。
3. 軸型及長度。
4. 端子型式。
5. 段點的有無。
6. 中間抽頭的有無。
7. 音量用或其他。
8. 手焊錫或錫爐焊錫。

ORDERING INSTRUCTIONS

WHEN PLACING YOUR ORDER, PLEASE SPECIFY THE FOLLOWING ITEMS ACCORDING TO YOUR APPLICATION NEEDS. FOR MORE INFORMATION ABOUT OUR PRODUCTS, PLEASE REFER TO THE SPECIFICATION GIVEN ON THE FOLLOWING PAGES.

ITEMS：

1. MODEL.
2. NORMAL RESISTANCE VALUE AND TAPER.
3. SHAFT STYLE AND LENGTH.
4. TERMINAL STYLE.
5. WITH CLICK OR WITHOUT CLICK, CLICK POSITION
6. WITH TAP OR WITHOUT TAP, TAP POSITION.
7. FOR VOLUME CONTROL OR OTHER USE.
8. MANUAL SOLDERING OR DIP SOLDERING.

[illegible]

For Shaft & Bushing Dimension please refer to page(69)
For PCB Mounting Hole Detail please refer to page(45)

RV16AF

MECHANICAL

TOTAL ROTATION ANGLE	300°±5°
ROTATION TORQUE	20-200 gf.cm
SHAFT STOP STRENGTH	6kgf.cm/Min.
CLICK POSITION	Center, 11, 21 or 41 positions
CLICK TORQUE	100-400 gf.cm


ELECTRICAL

RATED WATTAGE	linear taper (B)	other tapers
RATED VOLTAGE	0.125W	0.06W
INSULATION RESISTANCE	200V AC	150V AC
DIELECTRIC STRENGTH	more than 100MΩ at 500V DC	
TAP POSITION	500V AC, 1 minute	
TRACKING ERROR	50%(150°)	
	volume control:-40~0dB±3dB	
	tone,balance control: ±2dB at 50% point	

For Shaft & Bushing Dimension please refer to page(69)

STANDARD SHAFT, BUSHING, NUT AND WASHER DIMENSION

METAL SHAFT

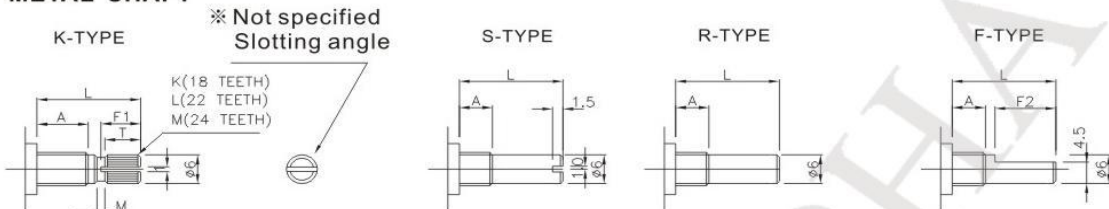


A: 5m/m

SHAFT-TYPE	L	10	15	20	25	30	35	40
K	F1	3.5	6.5	11	14	14	14	14
	T	3.2	6	10	12	12	12	12
	M	0.5	1	2	4	4	4	4
F	F2	4	7	12	14	14	14	14
R, S	L	10	15	20	25	30	35	40

A: 6.5m/m


SHAFT-TYPE	L	10	15	20	25	30	35	40
K	F1	2.4	6.5	11	14	14	14	14
	T	2.2	6	10	12	12	12	12
	M	0.5	1	2	4	4	4	4
F	F2	2.5	7	12	14	14	14	14
R, S	L	10	15	20	25	30	35	40

BUSHING

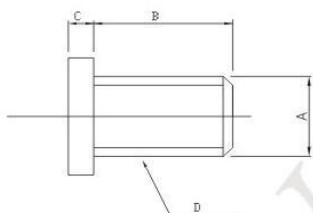


SERIES	RV24A	RV170	RV16A	RV060	RV120	RV122
A	ø8	ø7	ø7	ø9	ø7	7
B	6.5	5	6.5	7	7	7
C	2	1	1.4	0.7	3.3	3.3
D	M8x0.75	M7x0.75	M7x0.75	M9x0.75	M7x0.75	M7x0.75

NUT, WASHER

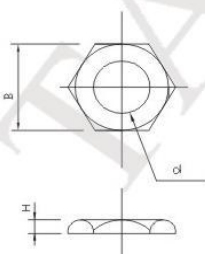

d	B	H
M6x0.75	8	2.0
M7x0.75	10	2.0
M8x0.75	11	2.0
M9x0.75	12	2.0
M10x0.75	14	2.0
3/8"32NEF	12.6	2.2



SERIES	d	D	H
M6	ø6.1	ø10	0.4
M7	ø7.1	ø12	0.4
M8	ø8.1	ø14	0.4
M9	ø9.1	ø14	0.4
M10	ø10.2	ø14.8	0.5
3/8"32NEF	ø9.7	ø16	0.4

Standard Angle (for 300° rotation)


AXIS Angle	Symbol
	F00, (O)
 105°	F01, (A)
 120°	F02, (B)
 135°	F03, (C)
 150°	F04, (D)
 165°	F05, (E)
	F06, (F)
 15°	F07, (G)
 30°	F08, (H)
 45°	F09, (J)
 60°	F10, (K)
 75°	F11, (L)

AXIS Angle	Symbol
	F12, (M)
 105°	F13, (N)
 120°	F14, (P)
 135°	F15, (Q)
 150°	F16, (R)
 165°	F17, (S)
	F18, (T)
 15°	F19, (V)
 30°	F20, (W)
 45°	F21, (X)
 60°	F22, (Y)
 75°	F23, (Z)


Axis angle is shown in full counter clockwise position

STANDARD RESISTANCE TAPER


TAPERS B SERIES

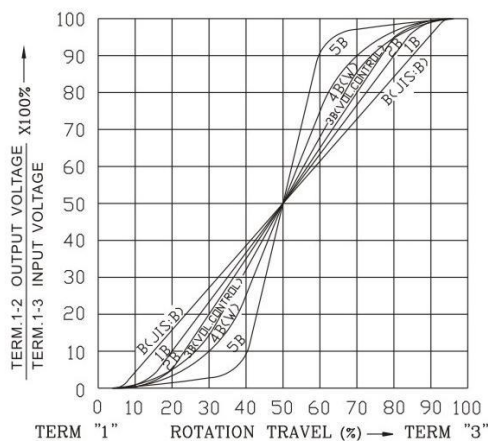


TAPERS B WITH 50% TAP

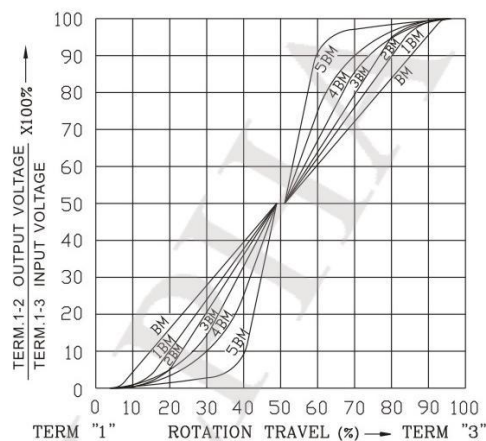


TAPERS A SERIES

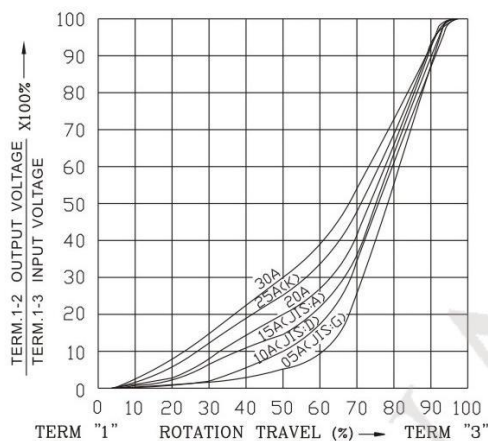

TAPERS A & C WITH 50% TAP

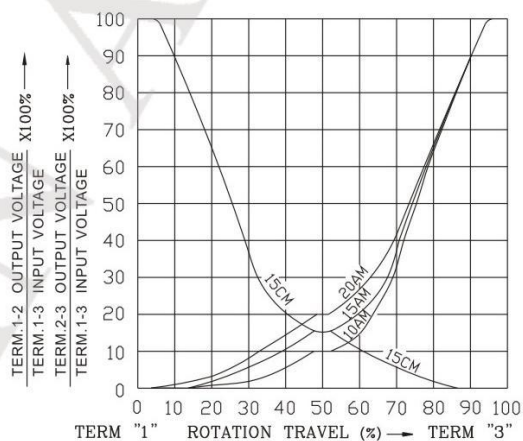

TAPERS C SERIES

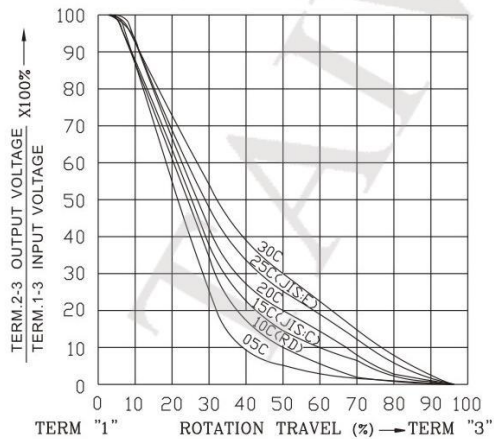

TAPERS M & N

