LASER SENSORS

MICRO

SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

CX-400

EX-10

EX-20

EX-30

EX-40

EQ-30 EQ-500 MQ-W

RX-LS200

RX

CY

PX-2

NX5 VF Amplifierseparated

RT-610

Power Supply Built-in

SU-7 / SH

SS-A5 / SH

Other Products


Compact Photoelectric Sensor

Related Information

General terms and conditions.....P.1 MS-AJ / CHX-SC2P.799 / P.800

Sensor selection guideP.11~ / P.229~ Glossary of terms / General precautions P.983~ / P.986~

Amplifier Built-in

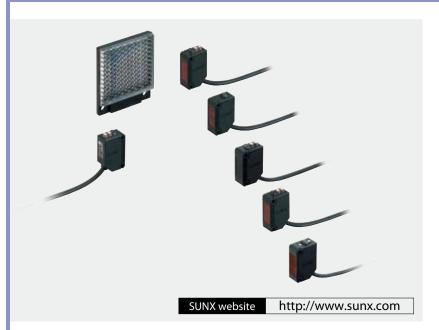













World standard photoelectric sensors Full line up 116 models!

Wide variety of 116 models

You can find your desired sensors among the CX-400 series because of their high basic performance, superior cost performance, and wide variation of types.

| Type | Sensing range |
|--------------------------------------------------|---------------------------------------------------------|
| Thru-beam (long sensing range) | ∫∫15 m 49.213 ft |
| Thru-beam | \$\sqrt{10 m 32.808 ft} |
| Retroreflective (long sensing range) | 5 m 16.404 ft |
| Retroreflective (with polarizing filters) | 3 m 9.843 ft |
| Retroreflective (for transparent object sensing) | 0.1 to 2 m 0.328 in 6.562 in |
| Retroreflective (for transparent object sensing) | 50 to 500 mm 1.969 to 19.685 in |
| Diffuse reflective (800 mm 9.843 in type) | 800 mm 9.843 in |
| Diffuse reflective (300 mm 11.811 in type) | 300 mm 11.811 in |
| Diffuse reflective (100 mm 3.937 in type) | 100 mm 3.937 in |
| Diffuse reflective (narrow-view type) | 70 to 200 mm 2.756 to 7.874 in |
| Adjustable range reflective | 20 to 300 mm 0.787 to 11.811 in |
| Adjustable range reflective | 15 to 100 mm 0.591 to 3.937 in |
| Adjustable range reflective | 2 to 50 mm 0.079 to 1.969 in |
| Adjustable range reflective (small spot) | 2 to 50 mm 0.079 to 1.969 in |
| Output NI | PN, PNP |
| Connecting method (Note 1) Ca | ble type, M8 Plug-in connector type, M12 Pigtailed type |
| Cable length of cable type (Note 2) 0. | 5 m 1.640 ft, 2 m 6.562 ft, 5 m 16.404 ft |

Notes: 1) The adjustable range reflective type includes the cable type and M8 connector type only.

2) The adjustable range reflective type includes the 2 m 6.562 ft cable type (standard) only.

Strong against oil and coolant liquids

The lens material for the thru-beam type, retroreflective type (excluding the CX-48) and the diffuse reflective type are made of a strong acrylic that resists the harmful effects of coolants. These sensors can be used with

confidence even around metal processing machinery that disperses oil mists. The

protection mechanism also conforms to IP67 (IEC).

Strong against ethanol

A strong, ethanol resistant polycarbonate was used for the front and display covers. Safe even for installing near food processing machinery that disperses ethanol based detergents. The protection mechanism also conforms to IP67 (IEC).





Caution: Set the CX-48 so that cleaning liquid will not get on to the attached reflector.




APPLICATIONS


Detecting out of position tape feeder cassette

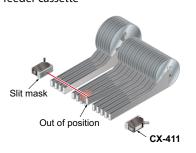

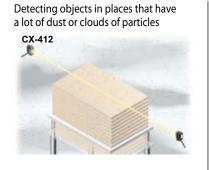


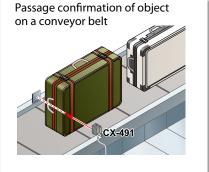

Detecting transparent glass bottles

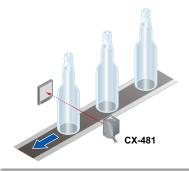



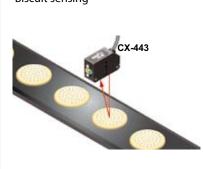

Biscuit sensing

SENSORS


DEVICES

MARKERS

BASIC PERFORMANCE

Strong infrared beam

The longest in its class, it realizes a 15 m 49.213 ft long-distance sensing range. Remarkable penetrating power enables applications such as package content detection. (Note)

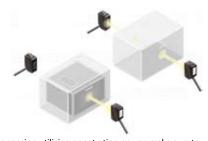


Note: When sensing utilizing penetrating power, make sure to verify using the actual sensor.

Hardly affected by color

CX-441/443

Both black and white objects can be sensed at the same distances. No adjuster control is needed, even when products of different colors are moving along the production line.

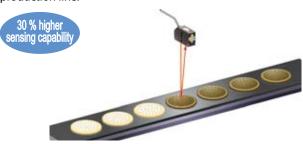

. The difference in sensing ranges is 1% or less between non-glossy white paper with a setting distance of 50 mm 1.969 in and non-glossy gray paper with a brightness level of 5. Can sense differences as small as 0.4 mm 0.016 in, CX-441/443 with hysteresis of 2 % or less

An advanced optical system provides sensing performance that is 2.5 times approx. than conventional models. Even ultra-small differences of 0.4 mm 0.016 in can be detected accurately.


Height differences of as little as 0.4 mm 0.016 in can be detected at a setting distance of 20 mm 0.787 in



Retroreflective type with polarizing filters

CX-491

Built-in polarizing filters ensure stable sensing even on a specular object.

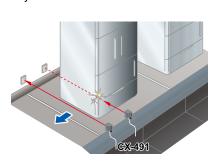

FIBER SENSORS

LASER SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASUREMENT

STATIC CONTROL

LASER

Selection Guide

CX-400 **EX-10**

EX-20

EX-30 EX-40

EQ-30 EQ-500

MQ-W

RX-LS200

RX

CY

PX-2

RT-610 Power Supply Built-in

NX5

Amplifierseparated

SU-7 / SH

SS-A5 / SH

Other Products



LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

> AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

> Selection Guide

> > **EX-10**

EX-20

EX-30

EX-40

EQ-30

EQ-500

MQ-W RX-LS200

RX


BASIC PERFORMANCE

Introducing the transparent object sensing type sensor

Transparent objects detectable with **CX-48**□ (Typical examples)

CX-48⊠

Our unique optical system and transparent object sensing circuitry provide stable sensing of even thinner transparent objects than the conventional models.

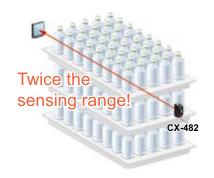

Sensing object Sensing object size (mm in) Glass sheet $t = 0.7 \ 0.028$ ø50 ø1.969 ℓ = 50 1.969 t = 1.3 0.051 Cylindrical glass □50 □1.969 t = 1.0 0.039 Acrylic board Styrol (Floppy case) □50 **□1.969** $t = 0.9 \ 0.035$ Food wrapping film **□50 □1.969** $t = 10 \mu m 0.394 mil$ Cigarette case film □50 □1.969 $t = 20 \mu m 0.787 mil$ □50 □1.969 t = 30 µm 1.181 mil Vinyl sack Pet bottle (500ml) ø66 ø2.598

Reflector setting range **CX-481**: 300 to 500 mm 11.811 to 19.685 in, **CX-482**: 1 to 2 m 3.281 to 6.562 ft

[with the **RF-230** reflector at the optimum condition (Note)] Each object should pass across the beam at the center between the sensor and the reflector.

- ℓ: Length of cylindrical glasses
- t: Thickness of sensing object

Note: The optimum condition is defined as the condition in which the sensitivity level is set such that the stability indicator just lights up when the object is absent.

Long sensing range of 5 m 16.404 ft

A long 5 m 16.404 ft sensing range is possible with the red LED type that is easy to align with the beam axis. Can be used for wide automatic door shutters.




CX-493

CX-412

Less power consumed

The CX-400 series sensors achieve a maximum of approx. 55 % the power consumption of conventional sensors. Contributes to preserving the environment.

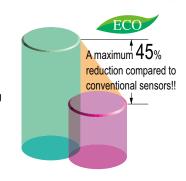

ENVIRONMENTAL RESISTANCE

Strong on dust and dirt


Because the light source is an infrared light, it is strong on dust and dirt compared to

the red beam type.



Strong against noise

Significantly stronger against inverter light and other extraneous light as well as high frequency and electromagnetic noise generated by high-pressure inverter motors and other devices.

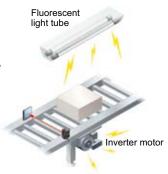

Strong even in cold environments

Stable performance can be maintained even in environments of -25 °C -13 °F.

PX-2

RT-610 Power Supply Built-in

NX5

VF Amplifierseparated

SU-7 / SH

SS-A5 / SH

Other Products

MOUNTING


Beam axis alignment made easy with a high luminance spot beam

CX-423

The bright spot makes beam axis alignment easy

CX-44⊠

These sensors realize a high luminance red LED spot that provides bright visibility enabling the sensing position to be checked at a glance. Because it has the smallest spot in its class, Ø2 mm Ø0.079 in approx., even the minutest object can be accurately detected.

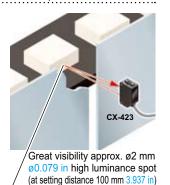

These sensors realize a high luminance red spot that provides bright visibility. The sensing position can be checked at a glance. Because the CX-441 sensor has the smallest spot in its class ø2 mm ø0.079 in approx., even the minutest object can be accurately detected.



OPERABILITY

Reduction of volume adjustment labor

CX-42⊠


Can be used for sensing minute differences

X-44⊠

Because these sensors possess many variations depending on the sensing range, enables you to make optimal volume adjustment easily.

Equipped with a 5-turn adjuster so that even challenging range settings can be handled with ease.



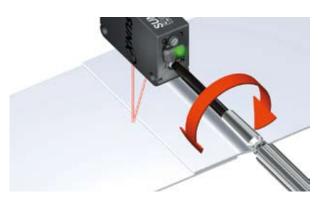

VARIETIES

Less processing


M8 plug-in connector type and M12 pigtailed type are available. This contributes to less time spent in setting up. In addition, cable types are available with cable lengths of 0.5 m 1.640 ft, 2 m 6.562 ft and 5 m 16.404 ft. This results in less wastage.


.....

Select from 2 spot diameters as per the application

CX-441/443

Within the choice of 50 mm 1.969 in sensing range sensors, we offer small spot approx. \emptyset 2 mm \emptyset 0.079 in type optimal for detecting minute object and large approx. \emptyset 6.5 mm \emptyset 0.256 in spot type capable of sensing object covered with holes and grooves.

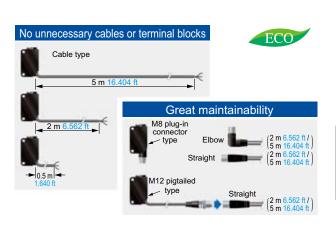

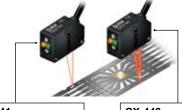

CX-441
Spot diameter: ø2 mm
ø0.079 in
approx.

[Positioning]
Detects minute holes.

CX-443 Spot diameter: ø6.5 mm

Detection of presence / absence of objects
Ignores minute holes and accurately detects objects.

approx.

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

> WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

Amplifier Built-in CX-400

EX-10 EX-20

EX-30

EX-40 EQ-30

EQ-500 MQ-W

RX-LS200

RX CY

PX-2

RT-610

Power Supply Built-in

NX5

VF Amplific

Amplifierseparated

SS-A5 / SH

Other Products



LASER SENSORS

MICRO PHOTOFI FCTRIC SENSORS

> AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS INDUCTIVE

SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide CX-400

> **EX-10** EX-20 **EX-30**

EX-40 **EQ-30**

EQ-500

MQ-W **RX-LS200**

RXCY

PX-2

RT-610 Power Supply Built-in

NX5

Amplifierseparated

SU-7 / SH SS-A5 / SH

Other Products

FUNCTIONS

BGS / FGS functions make even the most challenging settings possible!

CX-44⊠

For details on the operation of the BGS / FGS functions, refer to p.249, "BGS / FGS functions" of "PRECAUTIONS FOR PROPER USE".

The BGS function is best suited for the following case

Background not present

When object and background are separated


BGS

Background present

When object and background are close together When the object is glossy or uneven

The FGS function is best suited for the following case



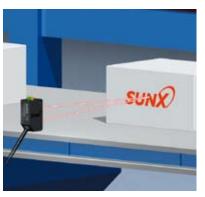



Not affected if the background

color changes or someone






Unaffected by gloss, color or uneven surfaces when sensing objects present on a conveyor belt.

BGS (Background suppression) function


The sensor judges that an object is present when light is received at position A of the light-receiving element (2-segment element).

This is useful if the object and background are far apart. The distance adjustment method is the same as the conventional adjustment method for adjustable range reflective type sensors.

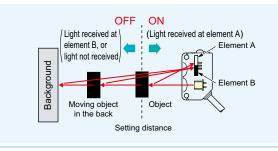

FGS (Foreground suppression) function


The sensor judges that an object is present when no light is received at position B of the light-receiving element (2segment element). Accordingly, even objects that are glossy can be sensed. This is useful if the object and background are close together, or if the object being sensed is glossy.

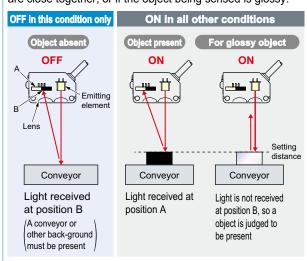

Strong against interference

The interference prevention function lets two sensors to be mounted close together precisely.



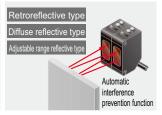

OTHERS

Less resources used

Based on environmental considerations, simplified packaging is used in order to reduce waste. In addition, the bag is made from polyethylene which produces no toxic gases even when burned.






ORDER GUIDE

| T | A | Consider your re- | Model No | o. (Note 1) | Emitting |
|---------------------------------------------|------------------------------------|------------------------------------------|------------|-------------|--------------|
| Type | Appearance | Sensing range | NPN output | PNP output | element |
| Thru-beam sensing | | 10 m 32.808 ft | CX-411 | CX-411-P | Red LED |
| Long | | 15 m 49.213 ft | CX-412 | CX-412-P | Infrared LED |
| With polarizing filters | | 3 m 9.843 ft (Note 2) | CX-491 | CX-491-P | 0-4150 |
| Retroreflective arent Long sensing range | | 5 m 16.404 ft (Note 2) | CX-493 | CX-493-P | Red LED |
| Ψ | | 50 to 500 mm 1.969 to 19.685 in (Note 2) | CX-481 | CX-481-P | Infrared IFD |
| Retror For transparent object sensing | 0.1 to 2 m 0.328 to 6.562 ft (Note | | CX-482 | CX-482-P | Infrared LED |
| | | 100 mm 3.937 in | CX-424 | CX-424-P | |
| flective | | 300 mm 11.811 in | CX-421 | CX-421-P | Infrared LED |
| Diffuse reflective | v | 800 mm 31.496 in | CX-422 | CX-422-P | |
| Narrow-view | | 70 to 200 mm 2.756 to 7.874 in | CX-423 | CX-423-P | Red LED |
| tive Small spot | | 2 to 50 mm 0.079 to 1.969 in | CX-441 | CX-441-P | |
| nge reflec | | 2 (3.50 min 0.07) (0 1.505 m) | CX-443 | CX-443-P | Pod LED |
| Adjustable range reflective | | 15 to 100 mm 0.591 to 3.937 in | CX-444 | CX-444-P | Red LED |
| Adji | | 20 to 300 mm 0.787 to 11.811 in | CX-442 | CX-442-P | |

NOTE: Mounting bracket is not supplied with the sensor. Please select from the range of optional sensor mounting brackets.

Notes: 1) The model No. with suffix "E" shown on the label affixed to the thru-beam type sensor is the emitter, "D" shown on the label is the receiver. (e.g.) Emitter of CX-411: CX-411E, Receiver of CX-411D

2) The sensing range of the retroreflective type sensor is specified for the RF-230 reflector. The sensing range represents the actual sensing range of the sensor. The sensing ranges itemized in "A" of the table below may vary depending on the shape of sensing object. Be sure to check the operation with the actual sensing object.

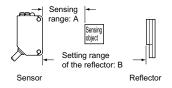

| | CX-491 ⊠ | CX-493 ⊠ | CX-481 ⊠ | CX-482 ⊠ |
|---|---------------------------------|----------------------------------|-------------------------------------|---------------------------------|
| Α | 0 to 3 m 0 to 9.843 ft | | 50 to 500 mm 1.969 to 19.685 in | 0.1 to 2 m 0.328 to 6.562 ft |
| В | 0.1 to 3 m 0.328 to 9.843 ft | 0.1 to 5 m 0.328 to 16.404 ft | 100 to 500 mm 3.937 to 19.685 in | 0.8 to 2 m 2.625 to 6.562 ft |

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY COMPONENTS PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS WIRE-SAVING SYSTEMS MEASURE-

SAVING SYSTEMS MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

> Selection Guide Amplifier Built-in CX-400

EX-20 EX-30

EX-40 EQ-30

EQ-500

MQ-W RX-LS200

CY

RT-610

Power Supply Built-in

VF Amplifier-

SU-7 / SH

SS-A5 / SH Other



ORDER GUIDE

LASER SENSORS

SENSORS

PHOTOELECTRIC

MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

STATIC CONTROL DEVICES LASER MARKERS

Selection Guide

EX-10

EX-20

EX-30 EX-40 EQ-30 EQ-500 MQ-W RX-LS200 RX CY 0.5 m 1.640 ft / 5 m 16.404 ft cable length types

 $0.5 \, \text{m} \, 1.640 \, \text{ft} \, / \, \text{5} \, \text{m} \, 16.404 \, \text{ft}$ cable length types (standard: $2 \, \text{m} \, 6.562 \, \text{ft}$) are also available. When ordering this type, suffix "-C05" for the $0.5 \, \text{m} \, 1.640 \, \text{ft}$ cable length type, "-C5" for the $5 \, \text{m} \, 16.404 \, \text{ft}$ cable length type to the model No. (Please note that $0.5 \, \text{m} \, 1.640 \, \text{ft}$ cable length type and $5 \, \text{m} \, 16.404 \, \text{ft}$ cable length type are not available for CX-44 .) (e.g.) $0.5 \, \text{m} \, 1.640 \, \text{ft}$ cable length type of CX-411-P is "CX-411-P-C05"

5 m 16.404 ft cable length type of CX-411-P is "CX-411-P-C5"

M8 plug-in connector type, M12 pigtailed type

M8 plug-in connector type and M12 pigtailed type are also available.

When ordering this type, suffix "-Z" for the M8 connector type, "-J" for the M12 pigtailed type to the model No. (Please note that M12 pigtailed type is not available for CX-44 .)

(e.g.) M8 connector type of CX-411-P is "CX-411-P-Z"

M12 pigtailed type of CX-411-P is "CX-411-P-J"

Mating cable (2 cables are required for the thru-beam type.)

| Туре | | Model No. Cable length | | Description |
|--------------------------------------|------------|------------------------|-----------------------------|-----------------------------|
| n o | Camaiadas | CN-24A-C2 | 2 m 6.562 ft | |
| For M8 plug-in connector type | Straight | CN-24A-C5 | 5 m 16.404 ft | Can be used with all models |
| M8 p | CN-24AL-C2 | 2 m 6.562 ft | Can be used with all models | |
| For | Elbow | CN-24AL-C5 | 5 m 16.404 ft | |
| e | 2-core | CN-22-C2 | 2 m 6.562 ft | For thru-beam type emitter |
| 2 d typ | z-core | CN-22-C5 | 5 m 16.404 ft | (2-core) |
| For M12 pigtalled type 3-core 5-core | CN-24-C2 | 2 m 6.562 ft | Can be used with all models | |
| b d 4-core | | CN-24-C5 | 5 m 16.404 ft | Can be used with all models |

Package without reflector


NPN output type: CX-491-Y PNP output type: CX-491-P-Y

Accessory


RF-230 (Reflector)



Mating cable

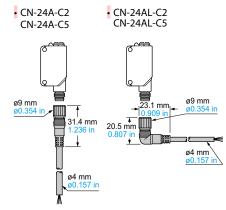

 CN-22-C2, CN-22-C5 CN-24-C2, CN-24-C5

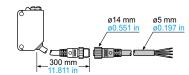

RT-610
Power Supply
Built-in
NX5
VF
Amplifierseparated
SU-7 / SH

SS-A5 / SH Other Products

SUNX

OPTIONS


| Model N | | el No. | Clin -i | Sensin | g range | Min. sensing object | |
|----------------------------------|------------|-----------------|------------------|------------------|--------------------|--------------------------|--------------------------------|
| Designation | Slit | Sensor | Slit size | Slit on one side | Slit on both sides | Slit on one side | Slit on both sides |
| | 00.07.05 | CX-411 ⊠ | ø0.5 mm | 400 mm 15.748 in | 20 mm 0.787 in | | ø0.5 mm ø0.020 in |
| | OS-CX-05 | CX-412 ⊠ | ø0.020 in | 600 mm 23.622 in | 30 mm 1.181 in | ø12 mm ø0.472 in | |
| Round slit mask /For thru-beam | OC CV 1 | CX-411⊠ | | 900 mm 35.433 in | 100 mm 3.937 in | #12 ··· · · · · 0 472 iv | ø1 mm ø0.039 in |
| (For thru-beam type sensor only) | US-CX-1 | CX-412 ⊠ | ø0.039 in | 1.35 m 4.429 ft | 150 mm 5.906 in | ø12 mm ø0.472 in | ø1.5 mm ø0.059 in |
| 06.64 | 00.07.3 | CX-411 ⊠ | ø2 mm | 2 m 6.562 ft | 400 mm 15.748 in | | ø2 mm ø0.079 in |
| | OS-CX-2 | CX-412 ⊠ | ø0.079 in | 3 m 9.843 ft | 600 mm 23.622 in | ø12 mm ø0.472 in | ø3 mm ø0.118 in |
| | OS-CX-05×6 | CX-411⊠ | 0.5 × 6 mm | 2 m 6.562 ft | 400 mm 15.748 in | | 0.5 × 6 mm 0.020 × 0.236 in |
| Rectangular | | CX-412 ⊠ | 0.020 × 0.236 in | 3 m 9.843 ft | 600 mm 23.622 in | ø12 mm ø0.472 in | |
| slit mask | 06.67.1.6 | CX-411 ⊠ | 1 × 6 mm | 3 m 9.843 ft | 1 m 3.281 ft | 42 0 470 1 | 1 × 6 mm |
| (For thru-beam type sensor only | OS-CX-1×6 | CX-412 ⊠ | 0.039 × 0.236 in | 4.5 m 14.764 ft | 1.5 m 4.921 ft | ø12 mm ø0.472 in | 0.039 × 0.236 in |
| (3), / | 00.07.20 | CX-411 ⊠ | 2 × 6 mm | 5 m 16.404 ft | 2 m 6.562 ft | | 2 × 6 mm 0.079 × 0.236 in |
| | OS-CX-2×6 | CX-412 ⊠ | 0.079 × 0.236 in | 7.5 m 24.606 ft | 3 m 9.843 ft | ø12 mm ø0.472 in | |

| Designation | Mode | el No. | Sensing range | Min. sensing object |
|-----------------------------------------|------------------------------|-----------------|---------------------------------------------|------------------------------|
| Interference prevention filter | PF-CX4-V (V 2 pcs. per se | | 5 m 16.404 ft (Note 1) | ø12 mm ø0.472 in (Note 1) |
| (For CX-441 only | PF-CX4-H (H 2 pcs. per se | | 5 m 16.404 ft (Note 1) | ø12 mm ø0.472 in (Note 1) |
| | | CX-491 ⊠ | 1 m 3.281 ft (Note 2) | |
| | RF-210 | CX-493 ⊠ | 1.5 m 4.921 ft (Note 2) | |
| | | CX-481 ⊠ | | ø30 mm ø1.181 in |
| Reflector | | CX-482 ⊠ | 0.1 to 0.6 m 0.328 to 1.969 ft (Note 2) | |
| (For retroreflective type sensor only | | CX-491 ⊠ | 1.5 m 4.921 ft (Note 2) | |
| (),,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,, | | CX-493 ⊠ | 3 m 9.843 ft (Note 2) | |
| | RF-220 | CX-481 ⊠ | 50 to 300 mm 1.969 to 11.811 in (Note 2) | ø35 mm ø1.378 in |
| | | CX-482 ⊠ | 0.1 to 1.3 m 0.328 to 4.265 ft (Note 2) | |

Notes: 1) Value when attached to both sides.

2) Set the distance between the CX-491 $\,$ /493 $\,$ and the reflector to 0.1 m 0.328 ft or more. However, see the table below for CX-48 .

The sensing range "A" may vary depending on the shape of sensing object. Be sure to check the operation with the actual sensing object.

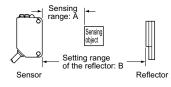

| Mode | el No. | _ | R | |
|-----------------|-----------|------------------------------------|-------------------------------------|--|
| Sensor | Reflector | A | В | |
| CX-481 ⊠ | RF-220 | 50 to 300 mm 1.969 to 11.811 in | 100 to 300 mm 3.937 to 11.811 in | |
| CV 402 9 | RF-220 | 0.1 to 1.3 m 0.328 to 4.265 ft | 0.5 to 1.3 m 1.640 to 4.265 ft | |
| CX-482 ⊠ | RF-210 | 0.1 to 0.6 m 0.328 to 1.969 ft | 0.3 to 0.6 m 0.984 to 1.969 ft | |

Round slit mask

OS-CX
■

Fitted on the front face of the sensor with one-touch.



Rectangular slit mask

• OS-CX-**⊠**×6

Fitted on the front face of the sensor with



Interference prevention filter


PF-CX4-V

PF-CX4-H

Two sets of CX-441 can be mounted close together.



Reflector

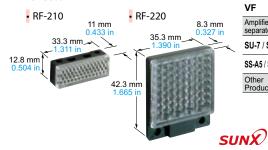

FIBER SENSORS

LASER SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

EX-10

EX-20 EX-30

EX-40 EQ-30

EQ-500

MQ-W RX-LS200

RX CY

PX-2

RT-610

Power Supply Built-in NX5

۷F Amplifier-

SU-7 / SH

SS-A5/SH

Other Products

LASER SENSORS

AREA SENSORS

SAFETY COMPONENTS PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR SENSORS

SENSOR OPTIONS WIRE-

SYSTEMS MEASURE-MENT SENSORS STATIC

DEVICES LASER MARKERS

Selection Guide

EX-10 EX-20 EX-30

EX-40 **EQ-30** EQ-500

RX-LS200 RX CY

MQ-W

PX-2 RT-610 Power Supply Built-in

NX5

۷F Amplifier-

SU-7 / SH SS-A5 / SH

Other Products


OPTIONS


| Designation | Model No. | Dose | ription | | | |
|----------------------------|-----------|----------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|--|--|--|
| Designation | Model No. | Desc | прион | | | |
| Reflector | MS-RF21-1 | Protective mounting bracket for RF-210 It protects the reflector from damage and maintains alignment. | | | | |
| mounting bracket | MS-RF22 | For RF-220 | | | | |
| | MS-RF23 | For RF-230 | | | | |
| | RF-11 | • Sensing range (Note 4):2 | nbient temperature: 5 to +50 °C –13 to +122 °F nbient humidity: 35 to 85 % RH | | | |
| Reflective tape | RF-12 | • Sensing range (Note 4): 0.7 m 2.297 ft [CX-491] 1.2 m 3.937 ft [CX-493] 0.1 to 0.6 m | eep the tape free from stress. If it is ressed too much, its capability may eteriorate. o not cut the tape. It will deteriorate he sensing performance. | | | |
| | RF-13 | 0.5 m 1.640 ft [CX-491] | nbient temperature: -25 to +55 °C -13 to +131 °F nbient humidity: 35 to 85 % RH | | | |
| | MS-CX2-1 | Foot angled mounting bracket It can also be used for mounting RF | 210. | | | |
| Sensor mounting bracket | MS-CX2-2 | Foot biangled mounting bracket It can also be used for mounting RF | The thru-beam type sensor needs two | | | |
| (Note 1) | MS-CX2-4 | Protective mounting bracket | brackets. | | | |
| | MS-CX2-5 | Back biangled mounting bracket | | | | |
| | MS-CX-3 | Back angled mounting bracket | | | | |
| | MS-AJ1 | Horizontal mounting type | Basic assembly | | | |
| | MS-AJ2 | Vertical mounting type | basic assembly | | | |
| Universal sensor | MS-AJ1-A | Horizontal mounting type | Lateral arms assembly | | | |
| mounting stand (Note 2) | MS-AJ2-A | Vertical mounting type | Lateral arm assembly | | | |
| , :=:==/ | MS-AJ1-M | Horizontal mounting type | Assembly for reflector | | | |
| | MS-AJ2-M | Vertical mounting type | Assembly for reflector | | | |
| Sensor checker (Note 3) | CHX-SC2 | It is useful for beam alignment of thru-beam type sensors. The optimum receiver position is given by indicators, as well as an audio signal. | | | | |

Notes: 1) The plug-in connector type sensor does not allow use of some sensor mounting brackets because of the protrusion of the connector.

- 2) Refer to p.799 for details of the universal sensor mounting stand.
- 3) Refer to p.800 for details of the sensor checker CHX-SC2.
- 4) Set the distance between the sensor and the reflective tape to 0.1 m 0.328 ft (CX-482 : 0.4 m 1.312 ft) or more.

Universal sensor mounting stand

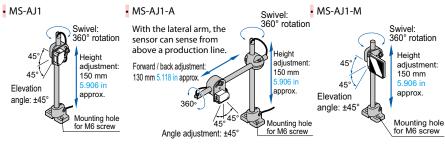

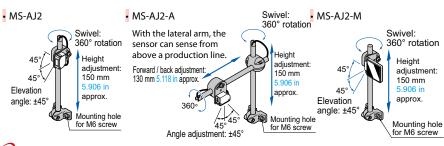

Reflector mounting bracket

MS-RF21-1



MS-RF22


Two M3 (length 12 mm washers are attached.

Two M3 (length 8 mm 0.315 in) screws with washers are attached.

MS-RF23



Reflective tape

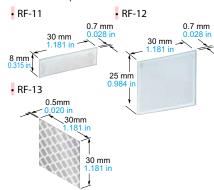

Sensor mounting bracket







Two M3 (length 12 mm 0.472 in) screws with washers are attached.

Two M3 (length 12 mm 0.472 in) screws with washers are attached.

MS-CX2-4





Two M3 (length 14 mm washers are attached.

Two M3 (length 12 mm






0.472 in) screws with washers are attached.

Two M3 (length 12 mm 0.472 in) screws with washers are attached.

Sensor checker

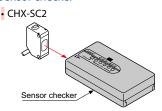



SPECIFICACTIONS

| | | | Thru- | beam | | Retroreflective | | | | | | |
|-------------------------------------|-------------------|-----------------------------------|-------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------|---------------------------------------------|------------------------------------------|---------------------------------------------------------------------------------------------------------|------------------------------|------------------------------|-------------------------------------------|
| | | Туре | '''' | Long sensing range | With polarizing filters | | I | t object sensing | | Diffuse r | eflective | Narrow-view |
| \ | Š | NPN output | CX-411 | CX-412 | CX-491 | Long sensing range CX-493 | CX-481 | CX-482 | CX-424 | CX-421 | CX-422 | CX-423 |
| Item | 등 / | PNP output | CX-411-P | CX-412-P | CX-491-P | CX-493-P | CX-481-P | CX-482-P | CX-424-P | CX-421-P | CX-422-P | CX-423-P |
| | ng range | | 10 m 32.808 ft | 15 m 49.213 ft | 3 m 9.843 ft (Note 2) | 5 m 16.404 ft (Note 2) | 50 to 500 mm 1,969 to 19.685 in (Note 2) | 0.1 to 2 m 0.328 to 6.562 ft (Note 2) | 100 mm 3.937 in (Note 3) | 300 mm 11.811 in (Note 3) | 800 mm 31.496 in (Note 3) | 70 to 200 mm 2.756 to 7.874 in (Note3) |
| Sensing object | | ø12 mm ø more opad (Note 4) | 0.472 in or | ## ## ## ## ## ## ## ## ## ## ## ## ## | | Opaque, translucent or transparent object (Note 5) | | or | Opaque, translucent or transparent object (Note 5) (Min. sensing object: ø0.5 mm ø0.020 in copper wire | | | |
| Hyste | eresis | | | | | | | | 15 % o | r less of opera | tion distance | (Note 3) |
| Repeata | ability (perpendi | icular to sensing axis) | | | 0.5 mm 0.0 | 20 in or less | | | 1 m | ım 0.039 in or | less | 0.5 mm 0.020 in or less |
| Supp | ly voltage | | | | | 12 to 24 | V DC ± 10 % | Ripple P-P 10 | % or less | | | |
| Curre | ent consum | ption | Emitter: 20 mA or less Receiver: 20 mA or less | Emitter: 25 mA or less Receiver: 20 mA or less | | 20 mA or less | | 25 mA or less | | 25 mA or less | | 20 mA or less |
| Outp | ut | | • Maxii • Appli | collector trans num sink curr ed voltage: 30 ' ual voltage: 1 | ctype> collector transistor pNP open-collector pNP open-collector pNP open-collector pNP open-collector pNP open-collector pNP open-collector pNP open-co | | | | | urrent) | | |
| | Output op | eration | | | | Switc | hable either L | ight-ON or Da | rk-ON | | | |
| | Short-circu | uit protection | | | | | Incorp | orated | | | | |
| Respo | onse time | | | | | | 1 ms | or less | | | | |
| Oper | ation indica | ator | | Orang | e LED (lights u | p when the o | utput is ON) (i | ncorporated o | n the receive | for thru-bear | n type) | |
| Stabi | lity indicato | or | Green LE | D (lights up un | der stable ligh | t received con | dition or stable | e dark conditio | n) (incorporat | ed on the rece | iver for thru-b | eam type) |
| Powe | er indicator | | Green LED (lights up is ON) (incorporated | | | | | | | | | |
| Sensi | tivity adjust | ter | | | Continuously | y variable adju | ıster (incorpoi | ated on the re | ceiver for thr | u-beam type) | | |
| | matic interf | | Two units of sensors can be mounted close together with interference prevention filters. (Sensing range: 5 m 16.404 ft) | | | Incorp | orated (Two u | ınits of sensor | s can be mou | nted close tog | ether.) | |
| | Protection | | | | | IP67 (IEC) (| Refer to p.984 | for details of | standards.) | | | |
| JCe | Ambient te | emperature | | – 25 to +55 ° | C –13 to +131 | °F (No dew co | ondensation o | r icing allowe | d), Storage: – | 30 to +70 °C − | 22 to +158 °F | |
| resistance | Ambient h | umidity | | | | 35 to | 85 % RH, Sto | rage: 35 to 85 | % RH | | | |
| resi | Ambient ill | luminance | | | | Incandescent | t light: 3,000 ℓ | x at the light-r | eceiving face | | | |
| ntal | EMC | | | | | | EN 609 | 947-5-2 | | | | |
| me | Voltage wi | thstandability | | 1,0 | 000 V AC for o | ne min. betwe | en all supply | terminals conr | nected togeth | er and enclos | ure | |
| Environmental | Insulation | resistance | | 20 MΩ, or | more, with 25 | 0 V DC megge | er between all | supply termin | als connected | l together and | d enclosure | |
| Env | Vibration r | esistance | | 10 to 500 H | z frequency, 1 | I.5 mm 0.059 i | n amplitude (| 10 G max.) in λ | ζ, Y and Z dire | ctions for two | hours each | |
| | Shock resis | | | | | | • | ζ, Y and Z dire | · | | | |
| Emitt | ing elemen | it (modulated) | Red LED | Infrared LED | | LED | | ed LED | | Infrared LED | | Red LED |
| | | ion wavelength | 680 nm 0.027 mil | 870 nm 0.034 mil | 680 nm 0.027 mil | 650 nm 0.026 mil | | 0.034 mil | 8 | 60 nm 0.034 n | | 645 nm 0.025 mil |
| Mate | | | - | ure: PBT (polyb | | | | | | | | |
| Cable | | | | ,po.yb | | | | : 2-core) cabty | | | | |
| | e extension | | Fxten | sion up to tota | | | | | | | mitter and rea | eiver). |
| Cable | | Net weight | | Receiver: 50 g approx. | | | | | pprox. | , pc. boule | tter and let | |
| Weig | ht ⊢ | Gross weight | | approx. | | e n 08 | pprox. | | F F | 60 a a | pprox. | |
| Acces | | | | | | | | | | | | |
| Accessory RF-230 (Reflector): 1 pc. | | | | L | | | | | | | | |

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of $+23\,^{\circ}\text{C} + 73.4\,^{\circ}\text{F}$.

2) The sensing range and the sensing object of the retroreflective type sensor are specified for the RF-230 reflector. The sensing range represents the actual sensing range of the sensor. The sensing ranges itemized in "A" of the table below may vary depending on the shape of sensing object. Be sure to check the operation with the actual sensing object.

| 6 | Sensing range: A | - | m |
|----------|------------------|-------------------------|---------------|
| | | Sensing object | |
| | Settin of the | g range reflector: B | \rightarrow |
| Sensor | | | Reflector |

| | CX-491 ⊠ | CX-493 ⊠ | CX-481 ⊠ | CX-482 ⊠ |
|---|-------------------|--------------------|--------------------|-------------------|
| Α | 0 to 3 m | 0 to 5 m | 50 to 500 mm | 0.1 to 2 m |
| | 0 to 9.843 ft | 0 to 16.404 ft | 1.969 to 19.685 in | 0.328 to 6.562 ft |
| В | 0.1 to 3 m | 0.1 to 5 m | 100 to 500 mm | 0.8 to 2 m |
| | 0.328 to 9.843 ft | 0.328 to 16.404 ft | 3.937 to 19.685 in | 2.625 to 6.562 ft |

- 3) The sensing range and the hysteresis of the diffuse reflective type sensor are specified for white non-glossy paper (200 × 200 mm 7.874 × 7.874 in) as the object.
- 4) If slit masks (optional) are fitted, an object of Ø0.5 mm Ø0.020 in (using round slit mask) can be detected.
- 5) Make sure to confirm detection with an actual sensor before use.



FIBER SENSORS

LASER SENSORS

> HOTO-LECTRIC ENSORS MICRO HOTO-ELECTRIC ENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

SENSORS STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide Amplifier Built-in

EX-20 EX-30

EX-40 EQ-30

MQ-W RX-LS200

RX CY

PX-2

RT-610 Power Supply Built-in

Built-in NX5

VF Amplifier-

SU-7 / SH

SS-A5 / SH Other

LASER SENSORS

ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS SAFETY COMPONENTS

PRESSURE SENSORS INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

SENSORS
STATIC
CONTROL
DEVICES
LASER
MARKERS

Selection Guide Amplifier Built-in

EX-10 EX-20 EX-30 EX-40 EQ-30

MQ-W RX-L\$200 RX

CY

EQ-500

PX-2
RT-610
Power Supply
Built-in

VF
Amplifierseparated
SU-7 / SH


NX5

SS-A5 / SH
Other
Products

SPECIFICACTIONS

| | Туре | Cmall are at | Adjustable ra | nge reflective | | | |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|---------------------------------------------------------------------------------------|-----------------------------------------------------------|----------------------------------------------------------|--------------------------------------------------------------------|--|--|
| 0 | NDN autout | Small spot | CV 442 | CV 444 | CV 442 | | |
| Item \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ | NPN output | CX-441 | CX-443 | CX-444 | CX-442 | | |
| | PNP output | CX-441-P | CX-443-P | CX-444-P | CX-442-P | | |
| Adjustable range | | 20 to 50 mm 0. | 787 to 1.969 in | 20 to 100 mm 0.787 to 3.937 in | 40 to 300 mm 1.575 to 11.811 ii | | |
| Sensing range (with wh | nite non-glossy paper) | er) 2 to 50 mm 0.079 to 1.969 in 15 to 100 mm 0.591 to 3.937 in 20 to 300 mm 0.787 to | | | | | |
| Hysteresis | | 2 % or less of c | pperation distance (with white nor | n-glossy paper) | 5 % or less of operation distance (with white non-glossy paper) | | |
| Repeatability | | Along sensing axis: 1 mm 0.0 | 039 in or less, Perpendicular to sen | sing axis: 0.2 mm 0.008 in or less (v | vith white non-glossy paper) | | |
| Supply voltage | | | 12 to 24 V DC ± 10 % | Ripple P-P 10 % or less | | | |
| Current consum | ption | | 25 mA | or less | | | |
| Output Output | | | | | r less (between output and +V) | | |
| Output op | eration | | Switchable either Detect | ion-ON or Detection-OFF | | | |
| Short-circu | uit protection | | Incorp | orated | | | |
| Response time | | | 1 ms | or less | | | |
| Operation indica | ator | | Orange LED (lights up | when the output is ON) | | | |
| Stability indicate | or | | Green LED (lights up under | stable operating condition) | | | |
| Distance adjuste | er | | 5-turn mecha | nical adjuster | | | |
| Sensing mode | | BGS | 5 / FGS functions Switchable with v | viring of sensing mode selection ir | put | | |
| Automatic interf | | | Incorp | orated | | | |
| Protection | | IP67 (IEC) (Refer to p.984 for details of standards.) | | | | | |
| Ambient te | emperature | −25 to +55 °C −13 to | o +131 °F (No dew condensation o | r icing allowed), Storage: –30 to + | 70 °C –22 to +158 °F | | |
| Ambient h | umidity | | 35 to 85 % RH, Sto | rage: 35 to 85 % RH | | | |
| Ambient il | luminance | | Incandescent light: 3,000 & | x at the light-receiving face | | | |
| EWC EWC | | | EN 609 | 947-5-2 | | | |
| Voltage wi | ithstandability | 1,000 V A | C for one min. between all supply t | terminals connected together and | enclosure | | |
| Ambient h Ambient il EMC Voltage wi Insulation | resistance | 20 MΩ, or more, v | vith 250 V DC megger between all | supply terminals connected toget | her and enclosure | | |
| D Vibration r | esistance | 10 to 500 H | z frequency, 3 mm 0.118 in amplito | ude in X, Y and Z directions for two | hours each | | |
| Shock resis | stance | 500 m | n/s ² acceleration (50 G approx.) in) | ζ, Y and Z directions for three time | s each | | |
| Emitting elemen | nt | | Red LED (Peak emission waveleng | gth: 680 nm 0.027 mil, modulated) | | | |
| Spot diameter | | ø2 mm ø0.079 in approx. (at 50 mm 1.969 in distance) | ø6.5 mm ø0.256 in approx. (at 50 mm 1.969 in distance) | ø9 mm ø0.354 in approx. (at 100 mm 3.937 in distance) | 15 mm 0.591 in approx. (at 300 mm 11.811 in distance) | | |
| Material | | Enclosure: PBT (Po | olybutylene terephthalate), Front o | over: Polycarbonate, Indicator cov | rer: Polycarbonate | | |
| Cable | | | 0.2 mm² 4-core cabtyre | cable, 2 m 6.562 ft long | | | |
| Cable extension | | Exter | nsion up to total 100 m 328.084 ft i | s possible with 0.3 mm², or more, o | able. | | |
| Weight | | | Net weight: 55 g approx., | Gross weight: 80 g approx. | | | |
| Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an Actual sensing range | | | | | | | |

- Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.
 - 2) The adjustable range stands for the maximum sensing range which can be set with the distance adjuster. The sensor can detect an object 2 mm 0.079 in [CX-444(-P): 15 mm 0.591 in, CX-442(-P): 20 mm 0.787 in], or more, away.
 - 3) Note that detection may be unstable depending on the mounting conditions or the sensing object. In the state that this product is mounted, be sure to check the operation with the actual sensing object.

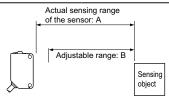


| | CX-441 \(\overline{A}\) 443 \(\overline{A}\) | CX-444 ⊠ | CX-442 ⊠ |
|---|------------------------------------------------------------|-------------------|--------------------|
| Α | 2 to 50 mm | 15 to 100 mm | 20 to 300 mm |
| | 0.079 to 1.969 in | 0.591 to 3.937 in | 0.787 to 11.811 in |
| В | 20 to 50 mm | 20 to 100 mm | 40 to 300 mm |
| | 0.787 to 1.969 in | 0.787 to 3.937 in | 1.575 to 11.811 in |



I/O CIRCUIT AND WIRING DIAGRAMS

NPN output type

I/O circuit diagram

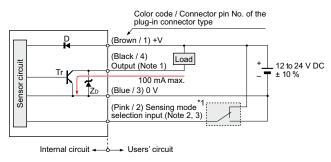


Notes: 1) The emitter of the thru-beam type sensor does not incorporate the output.

- 2) Sensing mode selection input is incorporated only for the CX-44 adjustable range reflective type. When using the CX-44, be sure to wire the sensing mode selection input (pink / 2).
- 3) When the mating cable is connected to the plug-in connector type of CX-44**Q**, its color is white.

Sensing mode selection input
BGS function: Connect to 0 V
FGS function: Connect to +V

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr : NPN output transistor

Wiring diagram

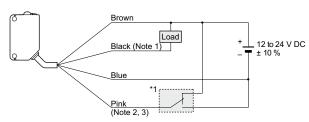


Notes: 1) The emitter of the thru-beam type sensor does not incorporate the black wire.

- 2) The pink wire is incorporated only for the CX-44 adjustable range reflective type. When using the CX-44, be sure to wire the pink wire.
- 3) When the mating cable is connected to the plug-in connector type of CX-44\(\mathbb{X}\), its color is white.
- Sensing mode selection input BGS function: Connect to 0 V FGS function: Connect to +V

Connector pin position

M8 plug-in connector type

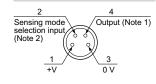

M12 pigtailed type

2
Not connected +V

3
0 V


Output (Note 1)

Notes: 1) The emitter of the thru-beam type sensor does not incorporate the output.

 Sensing mode selection input is incorporated only for the CX-44 adjustable range reflective type. When using the CX-44, be sure to wire the sensing mode selection input (pink / 2).

PNP output type

I/O circuit diagram

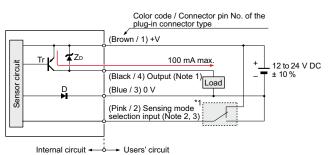


Notes: 1) The emitter of the thru-beam type sensor does not incorporate the output.

- Sensing mode selection input is incorporated only for the CX-44 -P adjustable range reflective type. When using the CX-44 -P, be sure to wire the sensing mode selection input (pink / 2).
- 3) When the mating cable is connected to the plug-in connector type of CX-44\overline{\overline{M}}-P, its color is white.

 Sensing mode selection input BGS function: Connect to 0 V FGS function: Connect to +V

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr : PNP output transistor

Wiring diagram

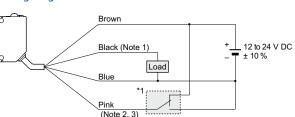


Notes: 1) The emitter of the thru-beam type sensor does not incorporate the black wire.

- 2) The pink wire is incorporated only for the CX-44 -P adjustable range reflective type. When using the CX-44 -P, be sure to wire the pink wire.
- 3) When the mating cable is connected to the plug-in connector type of CX-448-P, its color is white.


 Sensing mode selection input BGS function: Connect to 0 V FGS function: Connect to +V

Connector pin position

M8 plug-in connector type

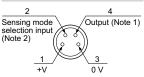

M12 pigtailed type

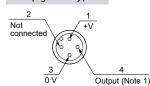

Notes: 1) The emitter of the thru-beam type sensor does not incorporate the output.
2) Sensing mode selection input is incorporated only for the CX-44 -P adjustable range reflective type. When using the CX-44 -P, be sure to wire the sensing mode selection input (pink / 2).

FIBER SENSORS LASER SENSORS

SENSORS

ELECTRIC SENSORS MICRO PHOTO-

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide Amplifier Built-in CX-400

EX-20 EX-30

EX-40 EQ-30

EQ-500 MQ-W

RX-LS200

CY

PX-2 RT-610

Power Supply Built-in

NX5

VF Amplifierseparated

separated SU-7 / SH

SS-A5 / SH Other Products



SENSING CHARACTERISTICS (TYPICAL)

LASER

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS
STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

EX-10

EX-20

EX-30

EX-40

EQ-30

EQ-500

MQ-W

RX-LS200

CY

PX-2 RT-610

Power Supply Built-in

Amplifier-

SU-7 / SH

SS-A5 / SH

Products


Other

NX5


۷F

LASER SENSORS CX-411


Parallel deviation

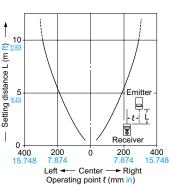


Angular deviation

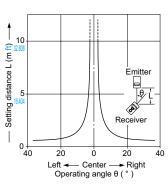


Parallel deviation with round slit masks (Ø0.5 mm Ø0.020 in)

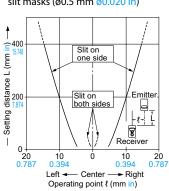


Parallel deviation with round slit masks (ø1 mm ø0.039 in)

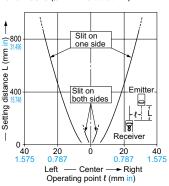


Parallel deviation with round slit masks (ø2 mm ø0.079 in)

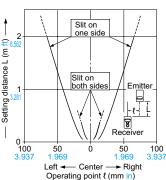


Parallel deviation with rectangular slit masks (0.5 \times 6 mm 0.020 \times 0.236 in)

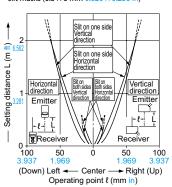

Parallel deviation with rectangular slit masks $(1 \times 6 \text{ mm } 0.039 \times 0.236 \text{ in})$

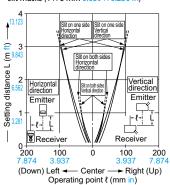


Parallel deviation with rectangular slit masks $(2 \times 6 \text{ mm } 0.079 \times 0.236 \text{ in})$

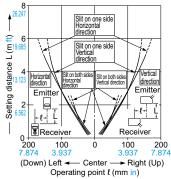


CX-412⊠


Parallel deviation

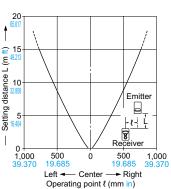

Angular deviation

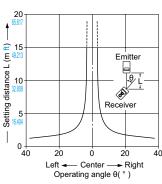


Parallel deviation with round slit masks (ø0.5 mm ø0.020 in)

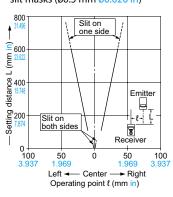


Parallel deviation with round slit masks (ø1 mm ø0.039 in)


Thru-beam type

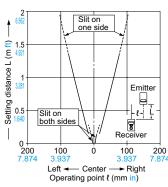


Parallel deviation with round slit masks (ø2 mm ø0.079 in)

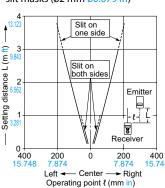


Parallel deviation with rectangular slit masks $(0.5 \times 6 \text{ mm } 0.020 \times 0.236 \text{ in})$

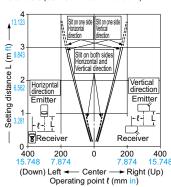

Parallel deviation with rectangular slit masks (1 \times 6 mm 0.039 \times 0.236 in)

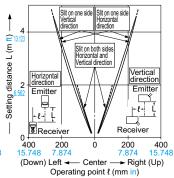


Parallel deviation with rectangular slit masks (2 \times 6 mm 0.079 \times 0.236 in)

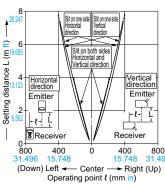




SENSING CHARACTERISTICS (TYPICAL)

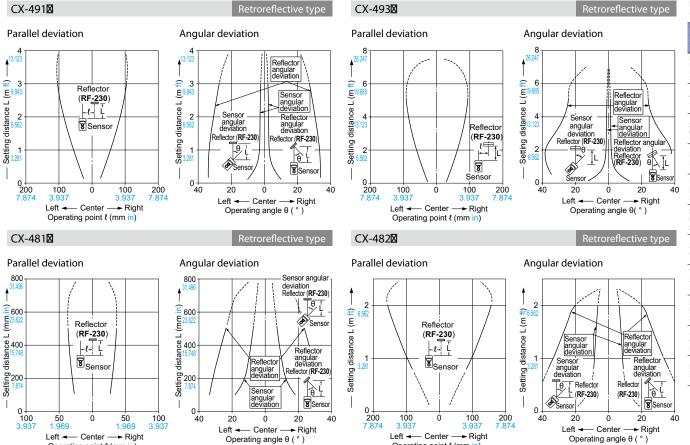


CX-424⊠ Diffuse reflective type



Correlation between sensing object size and sensing range

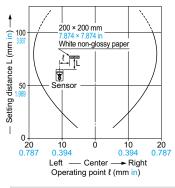

Operating point & (mm in)

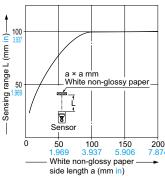


As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 \times 200 mm 7.874×7.874 in), the sensing range shortens, as shown in the left graph.

Operating point & (mm in)

For plotting the left graph, the sensitivity has been set such that a 200×200 mm 7.874×7.874 in white non-glossy paper is just detectable at a distance of 100 mm 3.937 in.

CX-421⊠



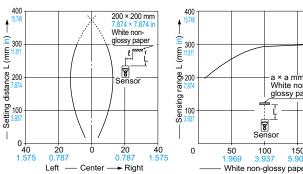

Operating point ℓ (mm in)

Correlation between sensing object size and sensing range

200 7.874

a×amm

White non-glossy paper

150

side length a (mm in)

As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 \times 200 mm 7.874 \times 7.874 in), the sensing range shortens, as shown in the left graph.

For plotting the left graph, the sensitivity has been set such that a 200 \times 200 mm 7.874 \times 7.874 in white non-glossy paper is just detectable at a distance of 300 mm 11.811 in.

FIBER SENSORS

LASER SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

CONTROL DEVICES

LASER MARKERS

Selection Guide

EX-10

EX-20 EX-30

EX-40 **EQ-30**

EQ-500

MQ-W RX-LS200

RX CY

PX-2

RT-610

Power Supply

Built-in NX5

۷F Amplifier-

SU-7 / SH SS-A5/SH

SENSING CHARACTERISTICS (TYPICAL)

200 × 200 mm

White non-

8

20 0.787

→ Right

glossy paper

LASER SENSORS

ELECTRIC SENSORS AREA SENSORS SAFETY COMPONENTS

L (mm

distance

Setting

500


PRESSURE SENSORS INDUCTIVE PROXIMITY SENSORS PARTICULAR SENSORS

SENSOR OPTIONS WIRE-SYSTEMS MEASURE-MENT SENSORS STATIC CONTROL DEVICES LASER MARKERS

CX-422⊠

Sensing field

Correlation between sensing object size and sensing range

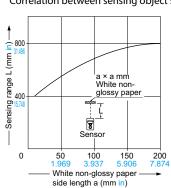

As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 \times 200 mm 7.874 \times 7.874 in), the sensing range shortens, as shown in the left graph.

For plotting the left graph, the sensitivity has been set such that a $200 \times 200 \text{ mm } 7.874 \times 7.874 \text{ in white non-glossy paper is just}$ detectable at a distance of 800 mm 31.496 in.

CX-423⊠

Left ◄


Center


Operating point (mm in)

Diffuse reflective type

Sensing field

Correlation between sensing object size and sensing range

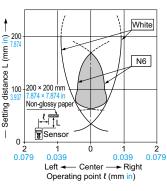

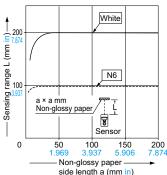

As the sensing object size becomes smaller than the standard size (white non-glossy paper 200 \times 200 mm 7.874 \times 7.874 in), the sensing range shortens, as shown in the left graph.

For plotting the left graph, the sensitivity has been set such that a 200×200 mm 7.874×7.874 in white non-glossy paper is just detectable at a distance of 200 mm 7.874 in.

Correlation between lightness and sensing range

N4 N6 Lightness

Sensing

N8

Light



range l EX-30 EX-40 N2 Dark -**EQ-30** N1 N2 N3 N4 N5 N6 N7 N8 N9

200

EQ-500 MQ-W RX-LS200 RX CY


PX-2 RT-610 Power Supply

NX5 ۷F Amplifier-

SU-7 / SH


SS-A5 / SH

Other

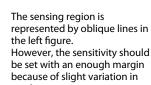

Lightness shown on the left may differ slightly from the actual object condition.

Emitted beam

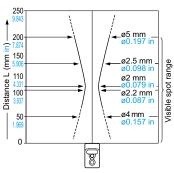




SENSING CHARACTERISTICS (TYPICAL)

CX-441


Adjustable range reflective type

Sensing fields

Setting distance: 25 mm 0.984 in

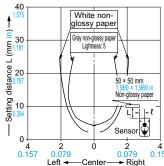

Operating point ℓ (mm in)

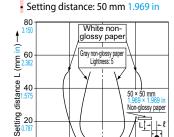


-Center-

Operating point ℓ (mm in)

► Right


Emitted beam

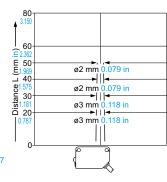

Correlation between color

 $(50 \times 50 \text{ mm } 1.969 \times 1.969 \text{ in construction paper})$ and sensing range

0 4 0.157

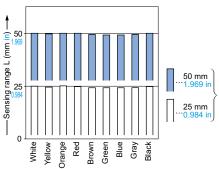


These bars indicate the sensing range with the respective colors when the distance adjuster is set to a sensing range of 50 mm 1.969 in and 25 mm 0.984 in long, respectively, with white color.

The sensing range also varies depending on material

Correlation between material

 $(50 \times 50 \text{ mm } 1.969 \times 1.969 \text{ in})$ and sensing range

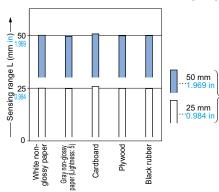


These bars indicate the sensing range with the respective objects when the distance adjuster is set to a sensing range of 50 mm 1.969 in and 25 mm 0.984 in long, respectively, with white non-glossy paper.


Adjustable range reflective type

CX-443⊠

Sensing fields


• Setting distance: 25 mm 0.984 in

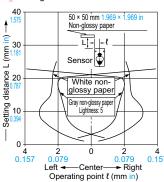

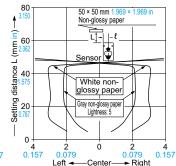


Setting distance: 50 mm 1.969 in

Emitted beam

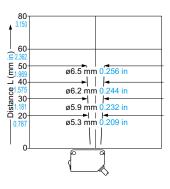

Correlation between color

(50 \times 50 mm 1.969 \times 1.969 in construction paper) and sensing range

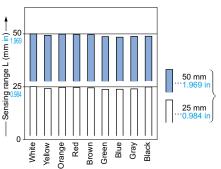


These bars indicate the sensing range with the respective colors when the distance adjuster is set to a sensing range of 50 mm 1.969 in and 25 mm 0.984 in long, respectively, with white color.

Operating point & (mm in)

The sensing range also varies depending on material.

Correlation between material

 $(50 \times 50 \text{ mm } 1.969 \times 1.969 \text{ in})$ and sensing range

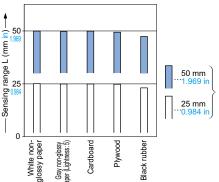

These bars indicate the sensing range with the respective objects when the distance adjuster is set to a sensing range of 50 mm 1.969 in and 25 mm 0.984 in long, respectively, with white non-glossy paper.

FIBER SENSORS

LASER SENSORS

> PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide Amplifier Built-in

EX-10 EX-20

EX-30 EX-40

> EQ-30 EQ-500

MQ-W RX-LS200

RX CY

PX-2

PX-2

RT-610 Power Supply Built-in

Built-in NX5

VF Amplifier-

SU-7 / SH

SS-A5 / SH Other

SUNX

LASER SENSORS

ELECTRIC SENSORS AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR SENSORS SENSOR OPTIONS

WIRE-SYSTEMS MEASURE-MENT SENSORS STATIC DEVICES LASER MARKERS

Selection Guide

EX-10

EX-20

EX-30

EX-40

EQ-30

EQ-500

MQ-W

RX-LS200

RX

CY

PX-2

RT-610

Power Supply Built-in

NX5

۷F

Amplifier-

SU-7 / SH


SS-A5 / SH


Products

Other


SENSING CHARACTERISTICS (TYPICAL)


CX-444⊠ Sensing fields

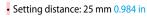

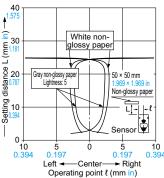




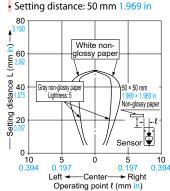

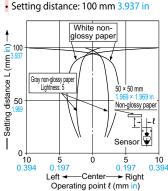


Emitted beam

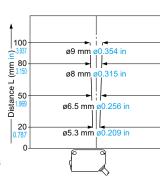

Adjustable range reflective type

Correlation between color



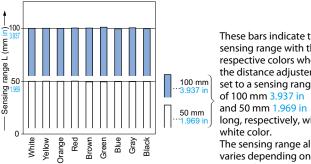


These bars indicate the sensing range with the respective colors when the distance adjuster is set to a sensing range of 100 mm 3.937 in and 50 mm 1.969 in long, respectively, with white color. The sensing range also

material.

Correlation between material

(50 \times 50 mm 1.969 \times 1.969 in) and sensing range

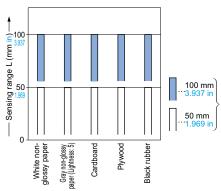



These bars indicate the sensing range with the respective objects when the distance adjuster is set to a sensing range of 100 mm 3.937 in and 50 mm 1.969 in long, respectively, with white non-glossy paper.

CX-442⊠


Sensing fields

• Setting distance: 100 mm 3.937 in

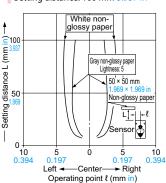

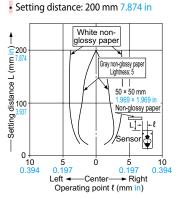


• Setting distance: 300 mm 11.811 in

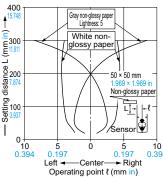


Adjustable range reflective type

Emitted beam

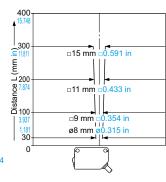

Correlation between color

 $(50 \times 50 \text{ mm } 1.969 \times 1.969 \text{ in construction paper})$ and sensing range

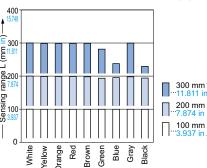


These bars indicate the sensing range with the respective colors when the distance adjuster is set to a sensing range of 300 mm 11.811 in, 200 mm 7.874 in and 100 mm 3.937 in long, respectively, with white

The sensing range also varies depending on material.

Correlation between material

 $(50 \times 50 \text{ mm } 1.969 \times 1.969 \text{ in})$ and sensing range

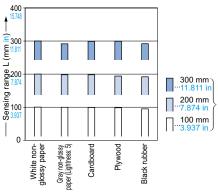

These bars indicate the sensing range with the respective objects when the distance adjuster is set to a sensing range of 300 mm 11.811 in, 200 mm 7.874 in and 100 mm 3.937 in long, respectively, with white non-glossy paper.



PRECAUTIONS FOR PROPER USE

Refer to p.986~ for general precautions.

All models

 Never use this product as a sensing device for personnel protection.

In case of using sensing devices for



 In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.


CX-49⊠ CX-48⊠

Retroreflective type sensor (excluding CX-491)

 Please take care of the following points when detecting materials having a gloss.

①Make L, shown in the diagram, sufficiently long.

②Install at an angle of 10 to 30 degrees to the sensing object.

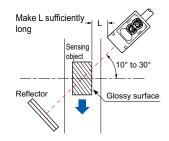

Retroreflective type sensor with polarizing filters (CX-491)

If a shiny object is covered or wrapped with a transparent film, such as those described below, the retroreflective type sensor with polarizing filters may not be able to detect it. In that case, follow the steps given below.

Example of sensing objects

- Can wrapped by clear film
- Aluminum sheet covered by plastic film
- Gold or silver color (specular) label or wrapping paper

Steps

- Tilt the sensor with respect to the sensing object while fitting.
- Reduce the sensitivity.
- Increase the distance between the sensor and the sensing object.

Mounting

 The tightening torque should be 0.5 N·m or less.




Others

 Do not use during the initial transient time (50 ms) after the power supply is switched on.


CX-48⊠


Retroreflective type sensor for transparent object sensing (CX-48)

 Optimum sensing is possible when the position of the transparent sensing object is set at the center of the sensor and the reflector. If the sensing position is set near the sensor or the reflector, the sensing may be unstable. In this case, set the sensing position at the center of the sensor and the reflector.

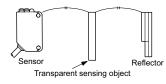

- When the sensor detects an uneven plastic receptacle or glass bottle, the received-light amount may differ with the sensing position or direction. Adjust the sensitivity after confirming the stable sensing condition by turning the sensing object, etc.
- When sensing pipe-shaped transparent sensing object, set it in a standing, not lying, position as shown in Figure A. The sensor may fail to detect a lying object as shown in Figure B.

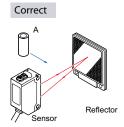

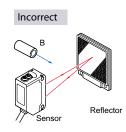

CX-44⊠

Mounting

 Care must be taken regarding the sensor mounting direction with respect to the object's direction of movement.

Correct Correct


Sensing object

Sensing object



Do not make the sensor detect an object in this direction because it may cause unstable operation.

 When detecting a specular object (aluminum or copper foil, etc.) or an object having a glossy surface or coating, please take care that there are cases when the object may not be detected due to a change in angle, wrinkles on the object surface, etc. • When a specular body is present below the sensor, use the sensor by tilting it slightly upwards to avoid wrong operation.

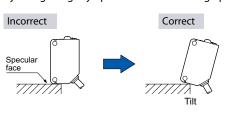

 If a specular body is present in the background, wrong operation may be caused due to a small change in the angle of the background body. In that case, install the sensor at an inclination and confirm the operation with the actual sensing object. FIBER SENSORS LASER SENSORS

SENSORS

MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR

USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS MEASURE-

MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

> Selection Guide Amplifier

CX-400 **EX-10**

EX-20 EX-30

EX-40 EQ-30

EQ-500

RX-LS200

CY

PX-2

RT-610
Power Supply
Built-in

NX5 VF

Amplifierseparated

SU-7 / SH SS-A5 / SH

Other Products



LACED

Refer to p.986~ for general precautions.

LASER SENSORS

PHOTO ELECTRI SENSOR MICRO PHOTO ELECTRIO

AREA SENSORS SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

EX-10

EX-20

EX-40 EQ-30

EQ-500 MQ-W

RX-LS200

RX

CY

PX-2

RT-610

Power Supply

Amplifier-

SU-7 / SH

NX5


۷F

CX-44⊠

Mounting

- Take care that there is a non-detectable area right in front of the sensor.
- Depending on whether you select the BGS or FGS function, the output operation changes as follows.

PRECAUTIONS FOR PROPER USE

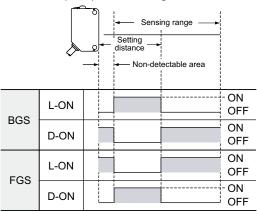


BGS / FGS functions

 This sensor incorporates BGS / FGS functions. Select either BGS or FGS function depending on the positions of the background and sensing object.


BGS function

 This function is used when the sensing object is apart from the background.

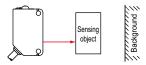

FGS function

 This function is used when the sensing object contacts the background or the sensing object is glossy, etc.

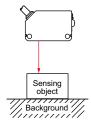

Distance adjustment



 When this product is used, be sure to carry out the distance adjustment.

• Since the distance adjuster of this sensor is a 5-turn adjuster, when the point (a) adjusted as explained in the table right, there may be more than 1 turn between the point (a) and (b). Therefore, make sure to remember the turns of both points to find the optimum position.

 Be sure to wire the sensing mode selection input (Pink / 2) before distance adjustment.
 If the wiring is done after the distance adjustment, the sensing area is changed.

 Turn the distance adjuster gradually and lightly with a "minus" screwdriver (please arrange separately). In order to protect itself, the distance adjuster idles if turned fully. If the adjuster is idled when distance adjustment is done, carry out the adjustment again.

When using the BGS function

<When a sensing object is moving right or left to the sensor>

| Step | Description | Distance |
|------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| | 2 3337, 11337 | adjuster |
| 1) | Turn the distance adjuster fully counterclockwise to the minimum sensing range position. (CX-441 /443 /444 : 20 mm 0.787 in approx., CX-442 : 40 mm 1.575 in approx.) | N F |
| 2 | Place an object at the required distance from the sensor, turn the distance adjuster gradually clockwise, and find out point (A)where the sensor changes to the detecting condition. | N P |
| 3 | Remove the object, turn the adjuster clockwise further until the sensor goes into the detecting state again. Once it has entered, turn the distance adjuster backward until the sensor returns to the non-detecting condition. This position is designated as point <code>BWhen</code> the sensor does not go into the detecting condition even if the adjuster is turned fully clockwise, the position where the adjuster was fully turned is regarded as the point <code>B</code> There may be more than 1 turn between point <code>A</code> and <code>B</code> since this sensor incorporates a <code>S-turn</code> adjuster. | N OFB |
| 4 | The optimum position to stably detect objects is the center point between (A) and (B) | A Optimum position |

<When a sensing object is approaching / moving away from the sensor>

 Follow only steps (and (2) since the sensing point may change depending on the sensing object, be sure to check the operation with the actual sensing object.

When using the FGS function

| When asing the Fas function | | | | |
|-----------------------------|------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|--|
| | Step | Description | Distance adjuster | |
| | 1) | Turn the distance adjuster fully clockwise to the maximum sensing range position. (CX-441 /443 :50 mm 1.969 in approx., CX-444 :100 mm 3.937 in approx., CX-442 :300 mm 11.811 in approx.) | N F | |
| | 2 | In the state where the sensor detects the background, turn the distance adjuster gradually counterclockwise, and find out point where the sensor changes to the non-detecting condition. | N F | |
| | 3 | Place an object at the required distance from the sensor, turn the adjuster counterclockwise further until the sensor goes into the non-detecting condition again. Once entered, turn the distance adjuster backward until the sensor returns to the detecting condition. This position is designated as point ® When the s ensor does not go into the non-detecting condition even if the adjuster is turned fully counterclockwise, the position where the adjuster was fully turned is regarded as the point ®. There may be more than 1 turn between point A and B since this sensor incorporates a S-turn adjuster. | | |
| | 4 | The optimum position to stably detect objects is the center point between (A) and (B) | Optimum A position | |

Others

 Its distance adjuster is mechanically operated. Do not drop; avoid other shocks.





DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com

CX-41⊠-Z

Sensor

Sensitivity adjuster (Note 1)

Operation indicator (Orange)(Note 2)

Stability indicator (Green)(Note 1)

Operation mode switch (Note 1)

11.9

0.469

7.85 0.309

3.95 0.156

Operation mode switch (Note 1)

0.787

0.118

Beam

axis

15.5 0.610

31

22.5

0.098

ø3.7 ø0.146 cable, 2 m 6.562 ft long

Sensor

Notes: 1) Not incorporated on the emitter.

CX-41⊠-J

thru-hole threads

2) It is the power indicator (green) on the emitter.

Sensitivity adjuster (Note 1) Operation indicator (Orange)(Note 2) **←** 7.85 0.309 3.95 0.156 Stability indicator (Green)(Note 1) Operation mode switch (Note 1) 20 0.787 __3 axis 15.5 2.5 31 35.5 $2-M3 \times 0.50.020$ thru-hole threads M8 connector

Notes: 1) Not incorporated on the emitter.

2) It is the power indicator (green) on the emitter.


Sensitivity adjuster (Note 1)

Operation indicator (Orange)(Note 2)

Stability indicator (Green)(Note 1)

Operation mode switch (Note 1)

Operation mode switch (Note 1)

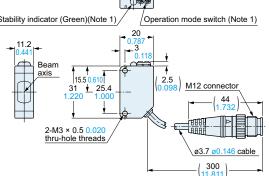


Notes: 1) Not incorporated on the emitter.


2) It is the power indicator (green) on the emitter.

CX-49図 CX-48図 CX-42図 Sensor Sensitivity adjuster Operation indicator (Orange 7.85 0.309 3 95 0 156 Stability indicator (Green) Operation mode switch 20 Beam-receiving Center of sensing 15.5 0.610 31 <u>v</u> 25.4 2-M3 × 0.5 0.020 Beam-emitting ø3.7 ø0.146 cable, 2 m 6.562 ft long thru-hole threads part

CX-49\overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\Overline{\

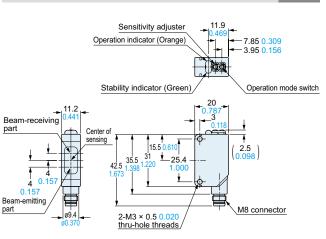

CX-49\(\mathbb{Q}\)-J CX-48\(\mathbb{Q}\)-J CX-42\(\mathbb{Q}\)-J Sensor

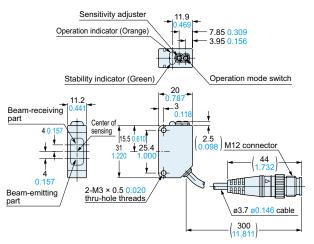

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

> Selection Guide Amplifier Built-in

EX-10 EX-20

EX-30 EX-40

EQ-30 EQ-500

MQ-W RX-LS200

RX

CY PX-2

RT-610


Power Supply Built-in

VF Amplifierseparated

separated SU-7 / SH

SS-A5 / SH Other



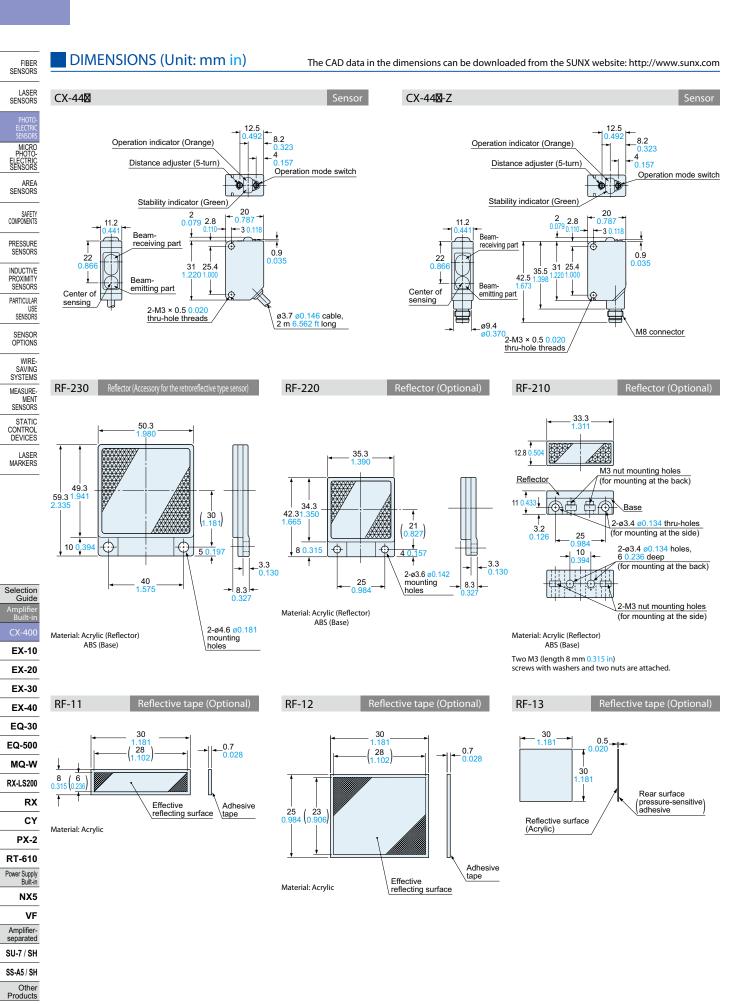



DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com

FIBER SENSORS

LASER SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide

EX-10 EX-20 EX-30

EX-40

EQ-30

EQ-500

MQ-W

RX-LS200


RT-610 Power Supply Built-in


RX

CY PX-2

Assembly dimensions

Mounting drawing with the receiver of CX-41

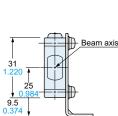

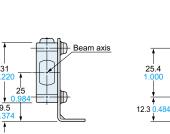


MS-CX2-2

Material: Stainless steel (SUS304)

MS-CX2-1

Assembly dimensions

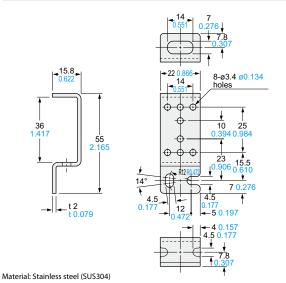

Two M3 (length 12 mm 0.472 in) screws with washers are attached

0.86 _ 15

R25

25

42.5 0

12.5

Two M3 (length 12 mm 0.472 in) screws with washers are attached.


2-ø3.4 ø0.134 holes

(for RF-210)

10


20

Mounting drawing with the receiver of CX-41

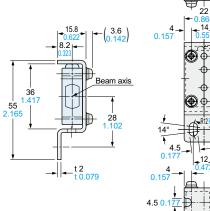


MS-CX2-4

Sensor mounting bracket (Optional)

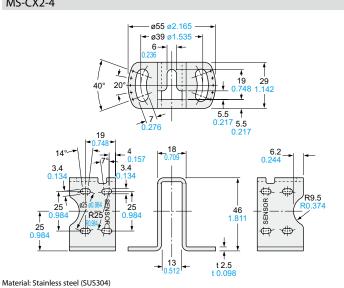

Assembly dimensions

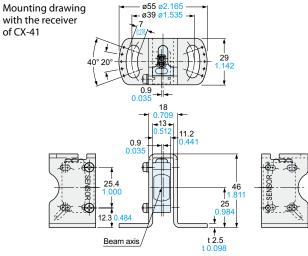

NX5 ۷F Amplifier-SU-7 / SH

SS-A5/SH

SUNX

Two M3 (length 14 mm 0.551 in) screws with washers are attached.

LASER SENSORS

AREA SENSORS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS

SAVING SYSTEMS MEASURE-

STATIC CONTROL DEVICES

Selection Guide

EX-10 EX-20 EX-30

MQ-W RX-LS200

CY PX-2

RT-610 Power Supply Built-in

NX5 ۷F

SU-7 / SH

SS-A5 / SH

Other Products

SAFETY COMPONENTS

PARTICULAR USE SENSORS

WIRE-

MENT SENSORS

LASER MARKERS

EX-40

EQ-30 EQ-500

RX


Amplifier-separated

SUNX


DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com

MS-CX2-5 Assembly dimensions

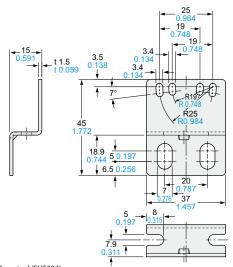

Mounting drawing with the receiver of CX-41

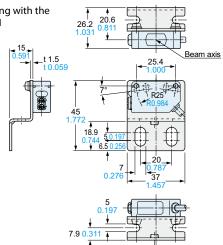


Sensor mounting bracket (Optional)

Material: Stainless steel (SUS304)

Two M3 (length 12 mm 0.472 in) screws with washers are attached.

MS-CX-3

Assembly dimensions Mounting drawing with the receiver of CX-41

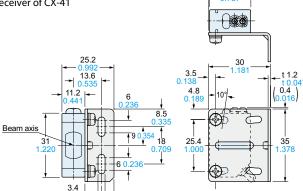

R25 35 25 984 R25 3.4


Material: Stainless steel (SUS304)


Two M3 (length 12 mm $0.472\,in$) screws with washers are attached.

MS-RF21-1

Reflector mounting bracket for RF-210 (Optional)

Assembly dimensions

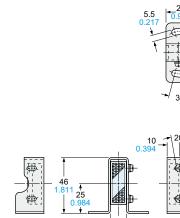

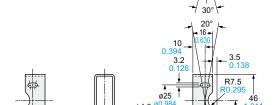

Material: Stainless steel (SUS304) Two M3 (length 12 mm 0.472 in) screws with washers are attached. The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com

FIBER SENSORS

LASER SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

PARTICULAR USE SENSORS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES


INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

LASER MARKERS

Assembly dimensions

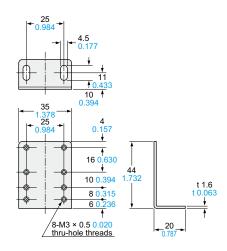

Material: Cold rolled carbon steel (SPCC) (Uni-chrome plated)

Two M3 (length 8 mm 0.315 in) screws with washers are attached.


MS-RF23

MS-RF22

Reflector mounting bracket for RF-230 (Optional)

∳ 8.3


4 0.157

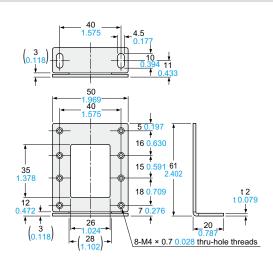

Material: Cold rolled carbon steel (SPCC)

Two M4 (length 10 mm 0.394 in) screws with washers are attached.

Assembly dimensions

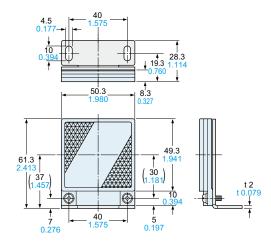

Selection Guide

EX-10 EX-20

EX-30 EX-40

EQ-30

EQ-500 MQ-W

RX-LS200

CY

PX-2

RT-610

Power Supply Built-in NX5

۷F Amplifier-

SU-7 / SH

SS-A5/SH